

Apr. 25th.

Wednesday Aug. 10, 1921.

Special Work:

I reported at the mill this morning
5:45 A.M.

Second hand put me on 22 looms in
#1 mill #3 weave room Kitchen #7
section I found the section has not
been kept up most all the shuttles
are badly worn caused by too much
power being on the picker stick
and many of the loom are out of
line and the pickers dont parallel right
I find many of the loom fixers
do not know how to line a loom
up a loom should be lined a
fraction out of line so as to
throw the shuttle off of the
reed a shuttle will soon wear
out if it rides the reed
loom fixers should line the loom up
so it will throw the shuttle
just a fraction toward the cloth

Humidity water pressure 175
This morning it was 82 dry 79 wet
83 " 80 "
85 " 82 "

This afternoon it was 86 dry 82 wet
86 " 83 "
86 " 83 "
86 " 84 "